


2011 Trinary II Mini-Cam Adjustment Chart - SUPREME PRO ELIMINATOR

PRODUCT:	INSERT	MODEL No.	xxxxxxxxxxx	DWG.No.	xxxxxxxxxxx	SCALE	c	MAT.		FINISH	xxxxxxxxx
RAW MAT.:		2/21/2011									

2011 TRINARY II MINI-CAM ADJUSTMENT CHART FOR THE SUPREME PRO.

WARNING:

THIS BOW CANNOT BE DRAWN OR SHOT WITHOUT THE DRAW STOP INSTALLED, AND SET IN THE PROPER POSITION. IF NOT PROPERLY INSTALLED, THE BOW COULD LOCK UP AND CAUSE INJURY. REFER TO THE CHART FOR THE PROPER SETTING.

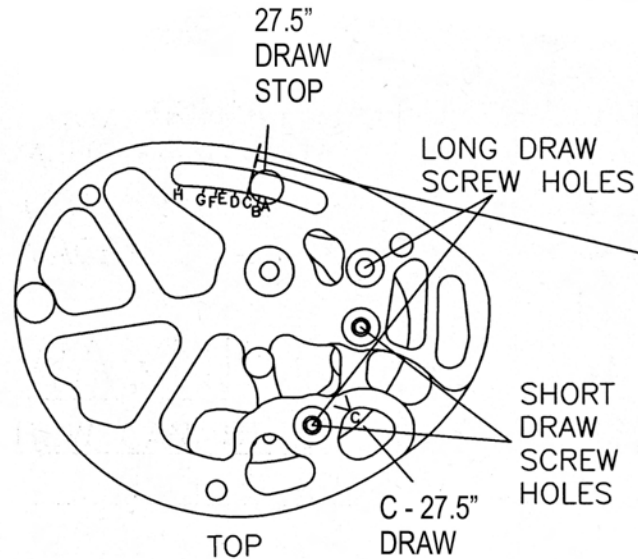

DRAW STOP MUST BE ON TOP WHEEL ON RH BOW. ALIGN LEFT SIDE OF DRAW STOP TO LENGTH NEEDED.

THE SETTINGS IN THIS DIAGRAM ARE FOR THE 80% LET-OFF, TO GET THE LOWER LET OFF IF REQUIRED, MOVE DRAW STOP TO THE RIGHT (ON A RH, AND LEFT ON A LH) OF THE PROPER LETTER TO ACHIEVE THE LOWER LET-OFF. NEVER GO ANY OTHER WAY THAN DESCRIBED OR THE BOW COULD LOCK UP AND CAUSE INJURY.

MINI DRAW MODULE

DRAW	IBO SPEED	DRAW STOP
A - 26.5	284/294	A
B - 27	293/303	B
C - 27.5	299/309	C
D - 28	306/316	D
E - 28.5	312/322	E

WARNING

THIS BOW CANNOT BE SHOT OR DRAWN WITHOUT THE DRAW STOP INSTALLED AND IN THE PROPER POSITION! IT IS BEST TO ADJUST THE DRAW STOP POSITION BEFORE SETTING MODULE POSITION.

<input checked="" type="checkbox"/> CRITICAL CHARACTERISTIC	PLCS
CAD. DWG.	DO NOT SCALE DRAWING
DIMENSIONS: <input checked="" type="checkbox"/> INCH <input type="checkbox"/> METRIC	
TOLERANCES UNLESS SPEC. OTHERWISE	
TAPERED THREADS -BASIC- $\frac{1}{2}$ THREAD	
ANGLES: $\pm 3'$ FRACTIONAL $\pm 1/32$	
INCH .X = $\pm .1$	METRIC X = ± 1 MM
.XX = $\pm .01$.XX = $\pm .5$ MM
.XXX = $\pm .005$.XXX = $\pm .25$ MM
BOW RATING	

DESIGNED BY:	ANY REPRODUCTION OF THIS PRINT WITHOUT WRITTEN CONSENT FROM HCA IS STRICTLY PROHIBITED. ARE RIGHTS RESERVED.
CHK'D. BY:	
DATE:	PRODUCT: Trinary II Cam
SCALE: NTS	MODEL NUMBER
MAT. SUPPLIER	DWG. NO.
	SHEET 1 OF 1
	REV.

